

DESCRIPTION AND MAINTENANCE INSTRUCTIONS**PLUGGING GENERATOR DRAIN HOLES**

(This EO replaces EO 05-45B-6A/152 dated 27 May 60)

GENERAL

To prevent the forward firewall area from becoming soaked with oil. The following procedure is to be followed prior to installing generators on Expeditor aircraft.

- (a) On each generator remove the four screws securing the back head (Refer EO 40-10BL-3) and rotate it until the four drain holes in the back head are exposed.
- (b) Plug these holes using an aluminum rivet type AN426A and of the correct diameter to give a press fit. Rivets should not be longer than 3/8" (rivets size cannot be specified as the holes vary from 3/16" to 5/16").
- (c) Reposition back head and replace screws.
- (d) Install generators.

ISSUED ON AUTHORITY OF THE CHIEF OF THE AIR STAFF