

STRUCTURAL REPAIR MANUAL

REPAIR SCHEME

TO STRIKE - CLUTCH RELEASE PEDAL COVER

INTRODUCTION

- 1 The strike Part 404-188951 is frequently found damaged, necessitating replacement.

INSTRUCTION

- 2 Carry out the replacement in accordance with the following information:-
 - (a) Remove the damaged strike by drilling the two rivets using a $3/16''$ drill.
 - (b) Locally manufacture the strike in accordance with Figure 1, using .048 4130 steel.
 - (c) Fit strike to plate item 2B, Figure 27, EO 05-45B-4 using cherry rivets 28NS/CR163-4-6.

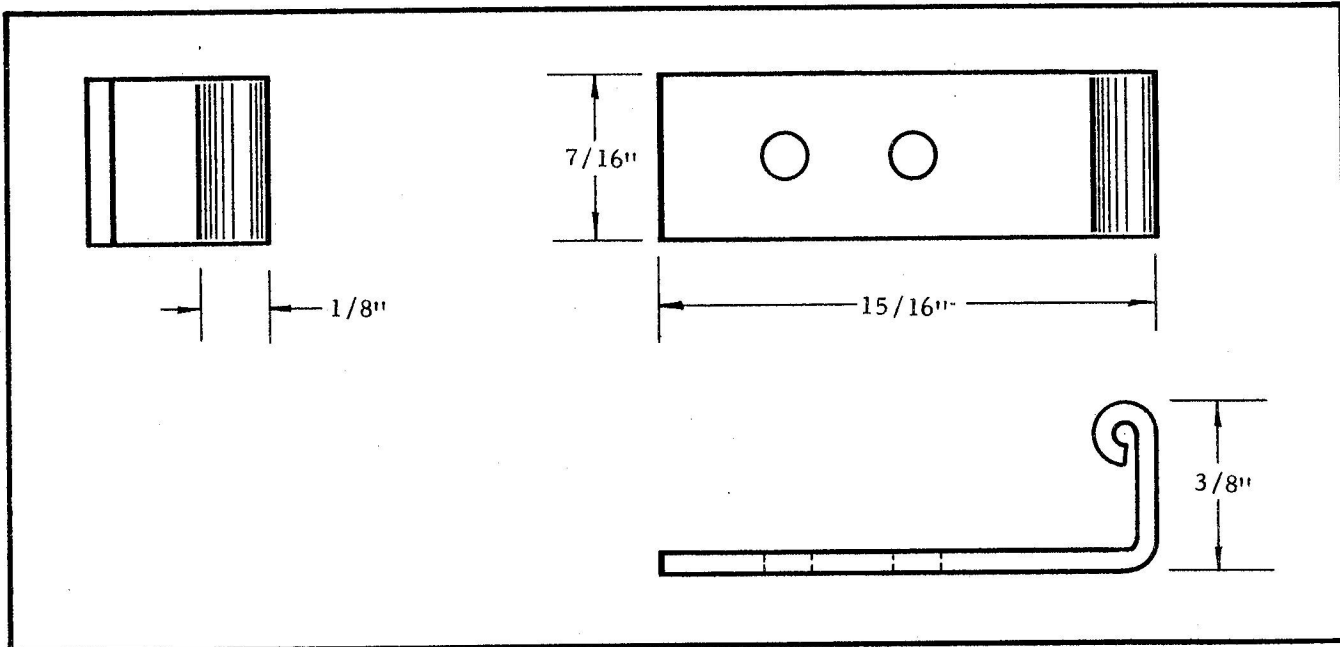


Figure 1

ISSUED ON AUTHORITY OF THE CHIEF OF THE AIR STAFF

Prepared By:-
AMC/SACO/ACR